


## WITH MOUNTING PLATE

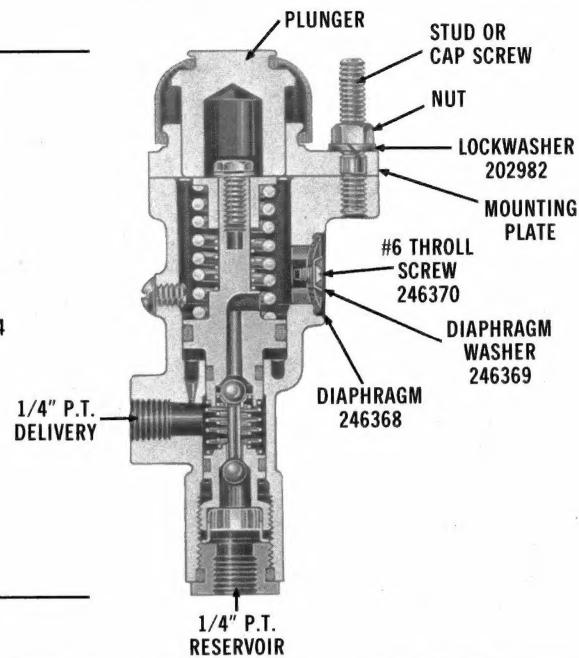

## DETAIL REFERENCE

TV-2 Aux. Foot Contr. Vlv. PC. NO.	Plunger PC. NO.	Mounting Plate PC. NO.	Stud or Cap Screw (e) PC. NO.	Nut (3) PC. NO.	Final Delivery Pressure (P.S.I.)
284339	248153	248616	211083	203145	MAX. RES.
284340	248153	248616	211083	203145	65
284723	248686	239079	203414	NONE	67

Repair of these valves in the field is not recommended because of the fine adjustments necessary for proper operation.

TV-1 TO TV-2 AUX. FOOT CONTROL  
AND CLUTCH VALVE CONVERSION LIST

TV-1 PC. NO.	TV-2 PC. NO.	Comment	Vehicle Manufacturer
101335	—	No Equiv. TV-2	Mack Service
101810	—	No Equiv. TV-2	Dart
224924	284338	—	Wilson Mfg. Crane Carrier
224925	284335	—	Unitrig, Skytop, Dart Ottawa, Hopper
224927	284336	—	FWD, Kenworth, Sicard
224928	284336	See Note#1	Kenworth, KW Dart Sicard, FWD
224929	284342	See Note #1	—
224930	284340	See note #1	Buffalo Springfield, Terex
224931	284340	See Note #1	Buffalo Springfield Terex
226980	284666	See Note #1	Thew
228438	284337	—	Thew
277027	284339	See Note #1	WABCO
278801	284344	—	Caterpillar
278802	—	No Equiv. TV-2	Terex, Euclid,
279208	284340	See Note #1	Buffalo Springfield
280300	284334	—	Caterpillar
280301	284344	—	Caterpillar
280313	—	No Equiv. TV-2	Oshkosh
281027	284334	—	Thew
282810	284335	—	Ottawa, Hopper
282913	284341	See Note #1	Thew
282945	283860	—	Eaton, IHC, Peterbilt, R & O Prod.

TV-1 PC. NO.	TV-2 PC. NO.	Comment	Vehicle Manufacturer
283076	284345	No Equiv. TV-2	Diamond Reo, Ford Caterpillar, GMC
283811	283860	—	—
284047	283860	—	—
284065	283860	—	IHC, Peterbilt
284375	284335	—	Unit rig, Skytop, Hopper, Ottawa
284745	—	No Equiv. TV-2	—
284746	—	No Equiv. TV-2	Mack
284747	—	No Equiv. TV-2	Mack
285142	—	—	—
285556	—	—	—
286270	—	No Equiv. TV-2	Service
286271	—	No Equiv. TV-2	Service
286272	—	No Equiv. TV-2	Service
286273	—	No Equiv. TV-2	Mack Service
286274	—	No Equiv. TV-2	Mack Service
—	284723	—	IHC
—	284877	See Note #2	Mack
—	285091	See Note #2	Mack
—	285105	—	Unit Rig
—	285748	—	—
—	286275	See Note #3	—
—	286276	See Note #3	—
—	287829	—	Kenworth
—	289996	—	Harnishfeger

NOTE 1: Changing from the TV-1 to the TV-2, some mounting changes are required. The TV-1 is a 2-hole mount-the TV-2 is a 3 hole mount. Both the TV-1 and its superseding TV-2 have the same delivery characteristics.

NOTE 2: Clutch Valve Assy. 284877 has clutch brake control 284876 installed with TV-2 Clutch Valve 285091 on a special mounting plate.

NOTE 3: Clutch Valve Assy. 286276 has clutch brake control 286273 installed with TV-2 Clutch Valve 286275 on a special mounting plate.